

Flextur™

Weld Tables & Workbenches

Care & Maintenance

Note: To insure many years of service from your Flextur Weld Table or Workbench we recommend the following care and maintenance.

Weld Table Care

Daily

1. Blow top surface off with high pressure air
2. Spray Weld Table top with anti-spatter before each job

Bi-Weekly

1. Spray table with WD-40
2. Polish using powered wire brush
(Air or Electric recommended)
3. Spray Weld Table top with anti-spatter

Workbench Care

Weekly

1. Spray Workbench Surface with WD-40
2. Wipe with Clean Dry Shop Towel

Tools Needed


- 1) WD-40 (aerosol can)
- 1) Anti-Spatter (aerosol can)
- 1) High Pressure Air
- 1) Power Wire Brush
- 1) Clean Dry Shop Towel




78909250_00 • WELD TABLE (36X30)




78909265_00 • WELD TABLE (72X36)

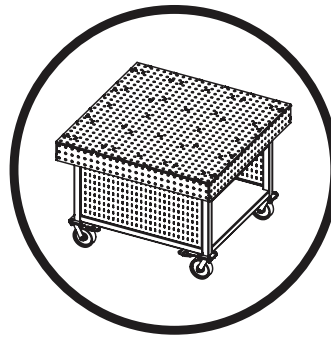


78909515_00 • WELD TABLE (48X48)

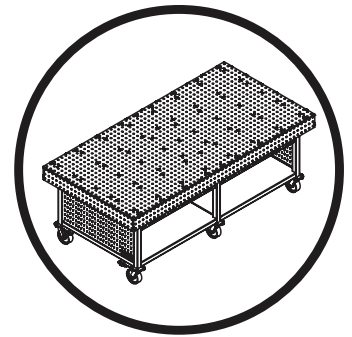

78909522_00 • WELD TABLE (96X48)

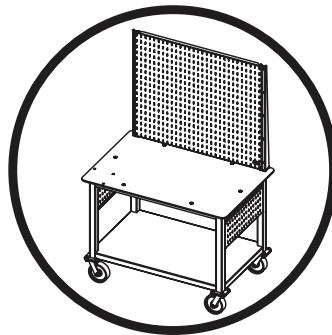

79059610_00 • WORK BENCH (48x32)
With 79058325 Gridlok Kit

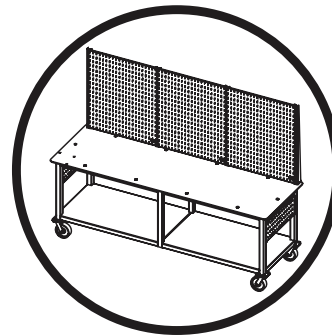

79059630_00 • WORK BENCH (96x32)
With 79058335 Gridlok Kit

Flextur™

16875 Jericho Road • Dalton, Ohio 44618
flexturusa.com • 877-435-3988

PATENT PENDING • MADE IN USA

98003800
052121